




## Torx Button Head Screws With Flange

A 6 lobe or torx driven variant of the popular flanged socket button screw. Again, torx button flange screws can be employed where aesthetics are important, or where space is limited.

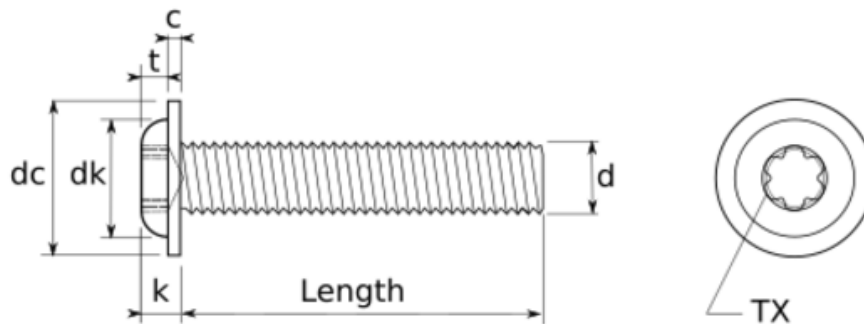

d	dc min.	dc max.	dk min.	dk max.	k min.	k max.	c min.	c max.	t	TX
<b>M3</b>	6.30	6.90	4.90	5.20	1.40	1.65	0.50	0.70	0.80	T10
<b>M4</b>	8.80	9.40	6.80	7.20	1.95	2.20	0.60	0.80	1.05	T20
<b>M5</b>	11.10	11.80	8.40	8.80	2.50	2.75	0.80	1.00	1.30	T25
<b>M6</b>	12.90	13.60	9.60	10.00	3.00	3.30	1.00	1.20	1.60	T30
<b>M8</b>	17.10	17.80	12.80	13.20	4.10	4.40	1.20	1.50	2.40	T40
<b>M10</b>	21.00	21.90	16.10	16.50	5.20	5.50	1.50	1.90	2.90	T50